



Release and Disclaimer

As material consideration for the sale and/or installation by 101220913 Saskatchewan Ltd. ("magdelete.com") of our aftermarket automotive suspension products and services related thereto, the purchaser agrees as follows:

DISCLAIMER OF WARRANTIES

To the maximum extent permitted by law, the magdelete.com services and products are provided on an "as is" and "as available" basis and the entire risk of installation, use and performance remains with you.

Magdelete.com hereby disclaims any implied conditions of merchantability, merchantable quality, safety, durability, or fitness for a particular purpose. If you are dissatisfied with the magdelete.com products or services, your sole remedy is to discontinue using the magdelete.com services or products.

DISCLAIMER OF CERTAIN DAMAGE

To the maximum extent permitted by law, in no event will magdelete.com be liable for any incidental, consequential, exemplary, punitive or special damages. This includes revenue, profits, property, injury, death, failure to meet a duty of good faith or reasonable care, negligence, and any other loss whatsoever arising from or relating to the magdelete.com services and products.

LIMITATION OF LIABILITY AND EXCLUSIVE REMEDIES.

To the maximum extent permitted by applicable law, magdelete.com's maximum, aggregate liability to you, and your exclusive remedy under this Release and Disclaimer for any and all damages, injuries, and losses arising from any and all claims and causes of action arising out of, based on, resulting from or in any way related to the magdelete.com services or products will not exceed the amount paid by you to magdelete.com in connection with the magdelete.com services or products.

Magdelete.com recommends a certified technician installs our products. Professional knowledge of disassembly and re-assembly as well as post installation checks must be followed. Attempts to install our products without expertise and knowledge may lead to unsafe operation of the vehicle. The purchaser expressly agrees to indemnify and hold harmless magdelete.com for all claims resulting from the purchase, ownership, or use of our products.

By installing our product, you agree to the above terms.

Magdelete.com Bypass Module Instructions (2021+ GM SUV Z95 ONLY)

DOES NOT FIT RPO F47 AIR SUSPENSION




Please note that all ride height sensors must remain connected and in the proper position!

Remove the two screws holding the OBD port to the dash. Plug the OBD port you just removed from the dash into the corresponding connector on the bypass module. You may attach the new OBD port (on the module) to the dash, using the same screws that you previously removed.



You will notice a long wire with a fuse tap connector on the end, this will need to be routed under the dash and through the center console to the fuse panel near the passenger door panel. Open the front passenger door and remove the fuse panel cover (where the dash meets the door). This can be done by carefully prying on the fuse panel door until the retaining clips pop free from the retainers.

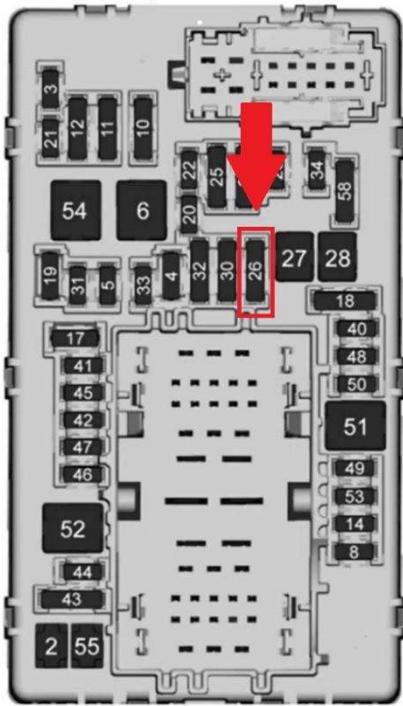

Carefully guide the wire with fuse tap up into the fuse panel and remove fuse # 26 (10 amp) per the photo. Take the fuse you just removed and push it into the open slot on the fuse tap (directly beside the 5 amp fuse that came installed in the fuse tap). Plug the fuse tap into location #26 and replace the fuse panel cover.

Note that all ride height sensors must remain connected. Turn the ignition on and start the vehicle. Verify that there are no suspension warning messages on the dash.

I still have a warning message on the dash!?? – To verify the module is working - once the battery is connected and the key is turned to the run position, there should be lights illuminated on the circuit board inside of the bypass box (you can remove the cover to verify). If no lights are illuminated, this means that the module is missing either 12V+ or negative which would require you to diagnose the reason for this. Use a test light or a multimeter to diagnose. Alternatively, you may have one or more ride height sensors that are not functioning or are out of range – use a scan tool to diagnose.

If you have any questions, please use the contact form on our website.